



THE WITTERN GROUP, INC.

8040 UNIVERSITY BLVD., DES MOINES, IA 50325

NO: 2001-02

BULLETIN

DATE: June 13, 2001

SUBJECT: CB700, CB300-SA, & CB300-SATL
Models 3151, 3172, 3172A, 3179, 3179A
Can/Bottle Vendor

SYMPTOM: Double vending of cans.

ACTION: Check Anti-Tip Finger.
Bend the finger to the correct angle.

WARNING:

To avoid electrical shock when performing service, disconnect the electrical power. Do not remove electrical components and parts without first unplugging the power cord from the power source.

1. Unlock and open the door. Find the **Power Panel** and turn off power.
2. Find the Anti-Tip Finger inside the Stack Assembly. It is located on the bottom near the Product Cradle. See **Figure 1** and **Figure 2**.
3. Check the Anti-Tip Finger to see if it is bent correctly. Use your finger to gently push it against the inner wall. It must swing freely towards the inner wall and the lower half must be flat against the inner wall. See **Figure 3** and **Figure 4**.
4. If it does not fit flat against the inner wall, then it needs to be adjusted.

To bend back, place one finger on the backside of the bend and push against it using the fingers of your other hand. Bend only at the bend-line to keep the bottom half of the part flat.

To bend forward, pull it forward against the stop and push. Bend only at the bend-line to keep the bottom half of the part flat.



Figure 1. Stack Assembly



Figure 2. Bottom View of Stack Assembly



Figure 3. Correct
No adjustment needed.

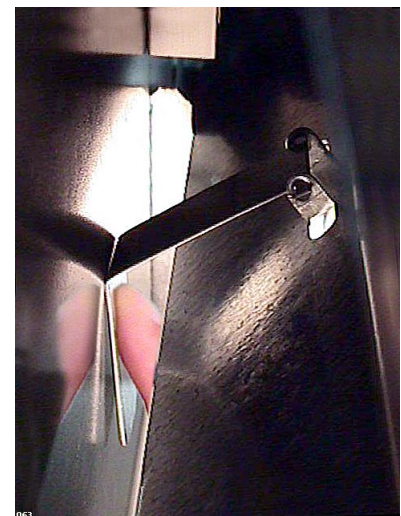


Figure 4. Wrong
Adjustment needed